

## DESIGN OF PERMANENT MAGNETS TO AVOID CHAOS IN PM SYNCHRONOUS MACHINES

Y. Gao and K. T. Chau

Department of Electrical & Electronic Engineering, The University of Hong Kong, Pokfulam Road, Hong Kong

### Purpose

The permanent-magnet synchronous machine (PMSM) is becoming more and more attractive for both industrial and electric vehicle applications [1] because of its inherent advantages of high power density and high efficiency. However, the investigation onto its chaos has been surprisingly little. Even so [2], the discussion was based on ad-hoc computer simulation, whereas the actual effect of PMs on the chaos in PMSMs was unexplored. In this paper, the relationship between the sizing of PMs and the chaos in PMSMs will be revealed. Both computer simulation and experimental results will be given to support the design criteria.

### Chaos

As shown in Fig. 1, a PMSM coupled with an induction motor (IM) is used for exemplification. The PMSM is modeled in d-q frame as given by (1). Under the conditions that the stator windings are short-circuited and the mechanical torque is equal to the PM torque, the PMSM model can be transformed into a dimensionless form as given by (2). Consequently, it can be deduced that the PM flux  $\psi_a$  exhibits an important effect on the system behavior: namely, normal stable operation is guaranteed only when  $\psi_a$  is lower than a critical value; otherwise, chaos may occur. This finding illustrates that the sizing of PMs is crucial to avoid chaos in PMSMs.

$$\begin{cases} L_{ds} \frac{di_{ds}}{dt} = -u_{ds} - R_s i_{ds} + \frac{P}{2} \omega_r L_{qs} i_{qs} \\ L_{qs} \frac{di_{qs}}{dt} = -u_{qs} - R_s i_{qs} - \frac{P}{2} \omega_r L_{ds} i_{ds} + \frac{P}{2} \psi_a \omega_r \\ J \frac{d\omega_r}{dt} = T_m - \frac{3P}{2} \psi_a i_{qs} + \frac{3P}{2} (L_{ds} - L_{qs}) i_{ds} i_{qs} - B\omega_r \end{cases} \quad (1)$$

$$\begin{cases} \frac{dx}{dt} = -bx + yz \\ \frac{dy}{dt} = -y - xz + cz \\ \frac{dz}{dt} = xy - az \end{cases} \quad (2)$$

### Results

As shown in Fig. 2, the bifurcation diagram of the rotor speed  $\omega_r$  with respect to  $\psi_a$  can be obtained from (2). It indicates that the critical value of  $\psi_a$  is 0.0634 Wb. When  $\psi_a = 0.117$  Wb, chaos occur. Fig. 3 shows the corresponding chaotic waveforms of  $i_{ds}$ ,  $i_{qs}$ , and  $\omega_r$  in time-domain as well as the trajectories on the  $i_{ds} - i_{qs}$ ,  $i_{ds} - \omega_r$  and  $i_{qs} - \omega_r$  planes. It can be found that the waveforms exhibit a well-known property of chaos (namely, random-like but bounded), while the trajectories resemble a butterfly (namely, the Lorenz attractors). Detailed simulation and experimental results will be included in the full version.

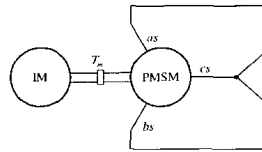


Fig. 1. The PMSM system.

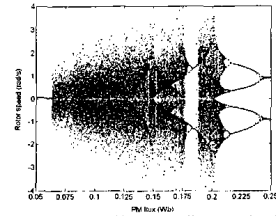


Fig. 2. Rotor speed bifurcation diagram via PM flux.

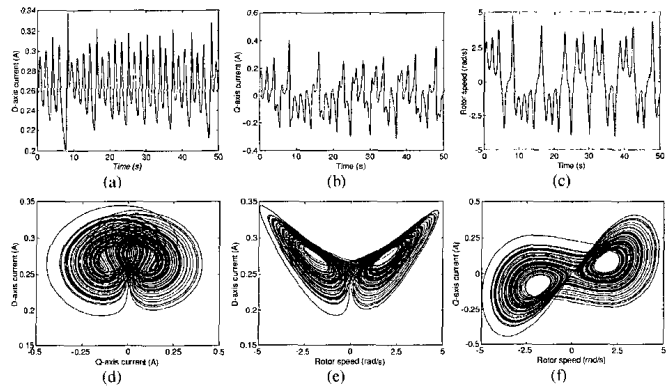


Fig. 3. Chaotic waveforms and trajectories of the PMSM.

### References

- [1] J. Gan, K.T. Chau, C.C. Chan and J.Z. Jiang, "A new surface-inset, permanent-magnet, brushless DC motor drive for electric vehicles," *IEEE Transactions on Magnetics*, Vol. 36, 2000, pp. 3810-3818.
- [2] N. Hemati, "Strange attractors in brushless dc motors," *IEEE Transactions on Circuits and Systems - I: Fundamental Theory and Application*, Vol. 41, 1994, pp. 40-45.